38800 Country Club Drive, Farmington Hills, MI 48331

Telephone: (248) 848-3180

Fax: (248) 848-3181

www.post-tensioning.org

ERRATA

PTI DC10.2-06: Construction and Maintenance Manual for Post-Tensioned Slab-on-Ground Foundations Third Edition 2006

DC-10 Slab-on-Ground Committee

The following errata items were added on 10/4/2010:

Page 13, Section 5.2.3:

"5.2 General Installation Procedures"


"3. All individuals involved in the <u>installation and</u> stressing operation should be certified as having successfully completed...."

Page 17, Section 5.2.16:

"16.The supports are placed at each tendon intersection and half way between intersections in cases where the tendon spacing exceeds 4 ft-6 in., as shown in Fig. 5.12".

Page 18, Fig. 5.12:

Replacement Fig. 5.12:

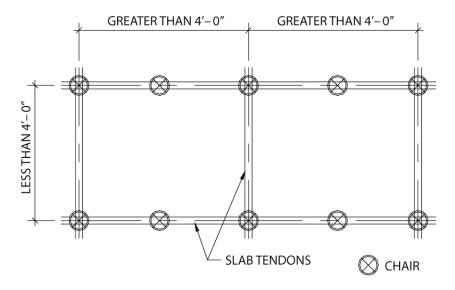

Page 39, Section 11.4.4:

"11.4 Honeycomb in Concrete"

"4. DO NOT use prepackaged concrete repair mixes or additives that contain calcium chloride or other material deleterious to prestressing steel".

Replace to read:

<u>"4. DO NOT use additives that contain calcium chloride or other material deleterious to prestressing steel. Instead, USE prepackaged concrete repair mixes".</u>

Page 48, Section 14.1.III.2:

"2. Cover Requirements:Slabs: Top <u>1-1/2</u> 2 in...."

Page 50, 14.3 Example Typical "Uniform Thickness" Foundation Plan:

Replacement Fig. B:

(B)

